

Piezoelectric Chip with Wires, 75 V, 2.0 µm Travel



Description

The PA2JEW piezoelectric chip consists of stacked piezoelectric ceramic layers (which are mechanically in series) that are sandwiched between interdigitated electrodes (which are electrically in parallel). It offers a maximum displacement of 2.0 µm ± 15%. A black dot is located next to the electrode that should receive positive bias; the other electrode should be grounded. The electrodes are bare.


Specifications

| PA2JEW ^a | |
|------------------------------------|--|
| Drive Voltage Range | 0 to 75 V |
| Displacement (Free Stroke) at 45 V | 2.0 μm ± 15% |
| Hysteresis | <15% (See Graph on Next Page) |
| Load for Maximum Displacement | 144 N (32 lbs) |
| Blocking Force at 45 V | 360 N (81 lbs) |
| Resonant Frequency | 450 kHz (No Load) |
| Impedance at Resonant Frequency | 100 mΩ |
| Anti-Resonant Frequency | 610 kHz |
| Dissipation Factor | <2.0% |
| Capacitance | 260 nF ± 15% |
| Operating Temperature | -25 to 130 °C |
| Curie Temperature | 230 °C |
| External Electrodes | Screen-Printed Silver |
| · | Width 1: 3.0 mm ± 0.1 mm |
| Dimensions | Width 2: $3.0 \text{ mm} \pm 0.1 \text{ mm}$ |
| | Height: 2.0 mm ± 5 μm |




All specifications are quoted at 25 °C, unless otherwise stated.

Drawing

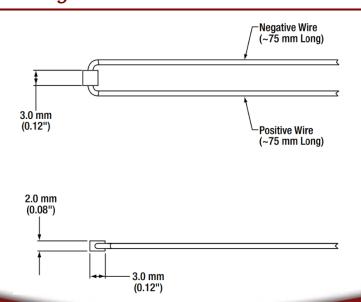



Typical Performance Plots

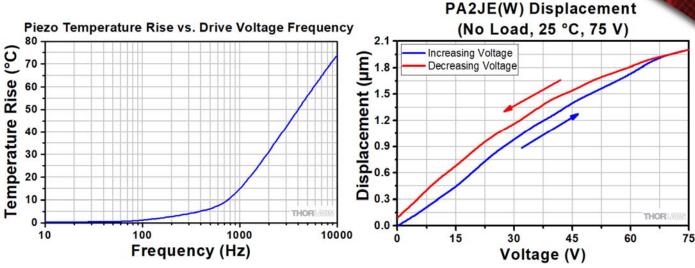

These temperature rises were measured after applying a sine-wave drive voltage ranging from 0 to 75 V at the specified frequency for 10 minutes.

Operation

Electrical Considerations

- The electrode attached to the red wire should be positively biased, and the electrode attached to the black wire should be grounded. The maximum drive voltage is 75 V. Exceeding 75 V will decrease the device's lifespan and may cause mechanical failure. Reverse biasing may cause mechanical failure.
- When soldering wires to the electrodes, use a temperature no greater than 370 °C (700 °F) for a maximum of 2 seconds per spot. Solder to the middle of the electrode, keeping the spot as small as possible.
- Caution: After driving, the piezo is fully charged. Directly connecting the red and black wires has the risk of electricity discharging, spark, and even failure. We recommend using a resistor (>1 $k\Omega$) between the wires to release the charge.

Attaching Devices to the Piezo

- Any epoxy which cures at a temperature lower than 80 °C is safe to use. We recommend Thorlabs item # 353NDPK or TS10. Loctite Hysol 9340 can also be used.
- Loads should only be attached to the central area of the chip face since the edges do not translate. Attaching a load to the non-translating faces may lead to mechanical failure.

Storage Instructions

- Do not store the device at temperatures above 80 °C.
- Do not store the device in humid environments. The relative humidity (RH) should be less than 40%.
- Do not immerse the device in organic solvents.
- Do not use the device around combustible gases or liquids.