


Piezoelectric Stack, 150 V, 20.0 μm , Two End Plates

PK4FTH3P2

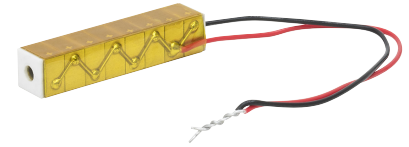


Description

The PK4FTH3P2 piezoelectric stack consists of multiple chips, each featuring a $\varnothing 2$ mm through hole, that are bonded together via epoxy and glass beads. The stack offers a maximum displacement of $20.0\mu\text{m} \pm 15\%$. A red wire is attached to the electrode that should receive positive bias, and a black wire is attached to the electrode that should be grounded.


Specifications

PK4FTH3P2 ^a	
Drive Voltage Range	0 - 150 V
Displacement (Free Stroke) at 150 V	20.0 $\mu\text{m} \pm 15\%$
Hysteresis	<15% (See Graph on Next Page)
Load for Maximum Displacement	300 N (68 lbs)
Blocking Force at 150 V	800 N (180 lbs)
Resonant Frequency	52 kHz (No Load)
Impedance at Resonant Frequency	200 m Ω
Dissipation Factor	<2.0%
Capacitance	1.3 $\mu\text{F} \pm 15\%$
Operating Temperature	-25 to 130 $^{\circ}\text{C}$
Curie Temperature	230 $^{\circ}\text{C}$
External Electrodes	Screen-Printed Silver
Outer Dimensions ^b	5.2 x 7.1 x 25.0 mm with 2 mm inner hole
Piezo Stack Dimensional Tolerance	± 0.1 mm


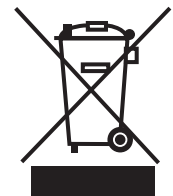


- All specifications are quoted at 25 $^{\circ}\text{C}$, unless otherwise stated.
- Outer dimensions include electrodes, wire connections, and Kapton[®] tape but not the wire lengths.

Drawing

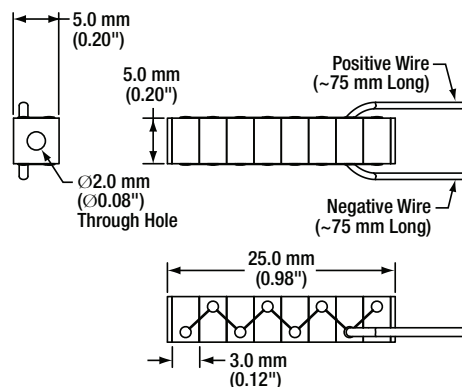

Typical Performance Plots

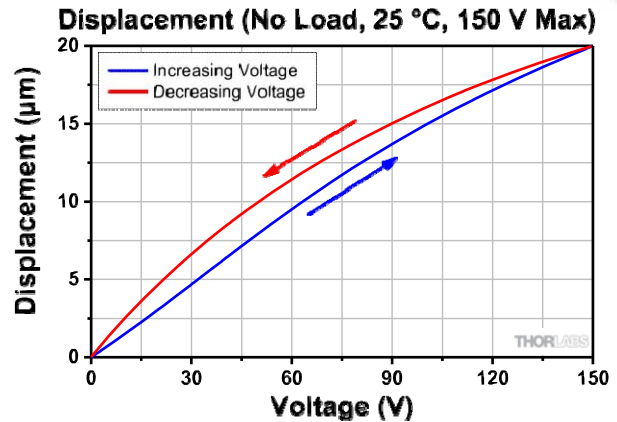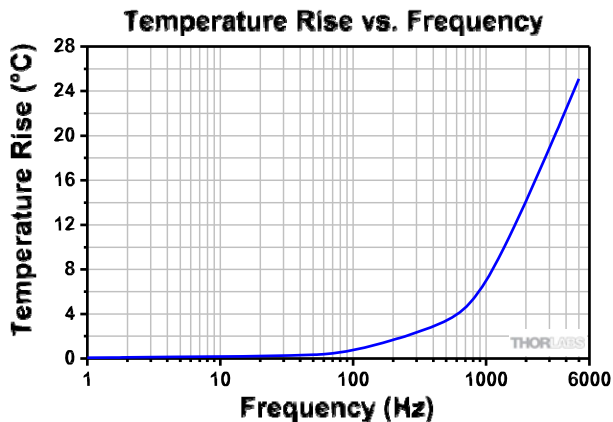

The temperature increase of the chip was measured after applying a sine-wave drive voltage, with maximum and peak-to-peak amplitudes of 150 V, at the specified frequency for 10 minutes.

Operation

Electrical Considerations

- The electrode attached to the red wire should be positively biased, and the electrode attached to the black wire should be grounded. The recommended maximum drive voltage is 150 V, and the absolute maximum voltage is 150 V. Exceeding 150 V will decrease the device's lifespan and may cause mechanical failure. Reverse biasing the device may cause mechanical failure.
- If it becomes necessary to reattach the wires to the electrodes, use a soldering iron at a temperature no greater than 370 °C (700 °F) for a maximum of 2 seconds per spot. Solder to the middle of the electrode, keeping the spot as small as possible.
- Caution: after driving, the piezo is fully charged. Directly connecting the red and black wires has the risk of electricity discharging, spark, and even failure. We recommend using a resistor (>1 kΩ) between the wires to release the charge.

Attaching Devices to the Piezo

- Any epoxy which cures at a temperature lower than 80 °C is safe to use. We recommend Thorlabs Item Numbers 353NDPK or TS10. Loctite Hysol 9340 is also acceptable.
- Loads should only be attached to the central area of the largest face since the edges do not translate. Attaching a load to the smaller faces may lead to mechanical failure.

Storage Instructions

- Do not store the device at temperatures above 80 °C.
- Do not store the device in humid environments. The relative humidity (RH) should be less than 40%.
- Do not immerse the device in organic solvents.
- Do not use the device around combustible gases or liquids.