

# Piezoelectric Stack, 75 V, 44.8 µm, One Spherical End



## **Description**

The PK2FVP1 piezoelectric stack consists of multiple chips which are bonded via epoxy and glass beads. It offers a maximum displacement of 44.8  $\mu$ m  $\pm$  15%. A red wire is attached to the electrode that should receive positive bias, and a black wire is attached to the electrode that should be grounded.


### **Specifications**


PK2FVP1 <sup>a</sup>	
Drive Voltage Range	0 - 75 V
Displacement (Free Stroke) at 75 V	44.8 μm ± 15%
Hysteresis	<15% (See Graph on Next Page)
Load (Recommended) <sup>b</sup>	400 N (90 lbs)
Blocking Force at 75 V	1000 N (225 lbs)
Resonant Frequency	30 kHz (No Load)
Impedance at Resonant Frequency	60 mΩ
Dissipation Factor	<2.0%
Capacitance	16.5 μF ± 15%
Operating Temperature	-25 to 130 °C
Curie Temperature	230 °C
External Electrodes	Screen-Printed Silver
Outer Dimensions	5.2 mm x 7.1 mm x 41.9 mm
Piezo Stack Dimensional Tolerance	±0.1 mm



- a. All specifications are quoted at 25 °C, unless otherwise stated.
- b. The displacement may vary slightly for different loads, and the maximum displacement occurs when used with the recommended load.


# **Drawing**

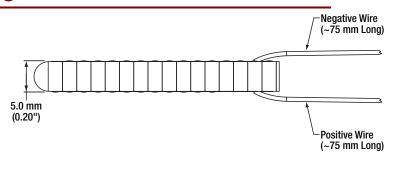






### **Typical Performance Plots**

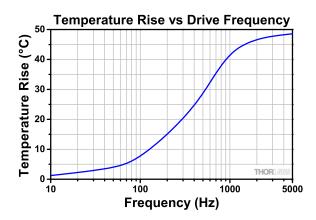

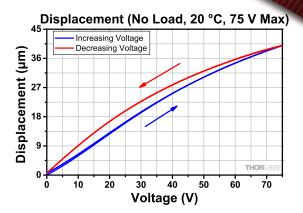

These temperature rises were measured after applying a sine-wave drive voltage ranging from 0 to 75 V at the specified frequency for 10 minutes.

### **Operation**

#### **Electrical Considerations**

- The electrode attached to the red wire should be positively biased, and the electrode attached to the black wire should be grounded. The recommended maximum drive voltage is 75 V, and the absolute maximum voltage is 75 V. Exceeding 75 V will decrease the device's lifespan and may cause mechanical failure. Reverse biasing the device may cause mechanical failure.
- If it becomes necessary to reattach the wires to the electrodes, use a soldering iron at a temperature no greater than 370 °C (700 °F) for a maximum of 2 seconds per spot. Solder to the middle of the electrode, keeping the spot as small as possible.
- Caution: After driving, the piezo is fully charged. Directly connecting the red and black wires has the risk of electricity discharging, spark, and even failure. We recommend using a resistor (>1 k $\Omega$ ) between the wires to release the charge.

#### Attaching Devices to the Piezo

- Any epoxy which cures at a temperature lower than 80 °C is safe to use. We recommend Thorlabs Item Numbers 353NDPK or TS10. Loctite Hysol 9340 is also usable.
- Loads should only be attached to the ceramic mounting plates. Attaching a load to any other sides may lead to mechanical failure.

#### Storage Instructions

- Do not store the device at temperatures above 80 °C.
- Do not store the device in humid environments. The relative humidity (RH) should be less than 40%.
- Do not immerse the device in organic solvents.
- Do not use the device around combustible gases or liquids.