

PA2JE



### Description

The PA2JE piezoelectric chip consists of stacked piezoelectric ceramic layers (which are mechanically in series) that are sandwiched between interdigitated electrodes (which are electrically in parallel). It offers a maximum displacement of  $2.0 \mu\text{m} \pm 15\%$ . A black dot is located next to the electrode that should receive positive bias; the other electrode should be grounded. The electrodes are bare.


### Specifications

PA2JE <sup>a</sup>	
Drive Voltage Range	0 to 75 V
Displacement (Free Stroke) at 45 V	$2.0 \mu\text{m} \pm 15\%$
Hysteresis	<15% (See Graph on Next Page)
Load for Maximum Displacement	144 N (32 lbs)
Blocking Force at 45 V	360 N (81 lbs)
Resonant Frequency	450 kHz (No Load)
Impedance at Resonant Frequency	100 m $\Omega$
Anti-Resonant Frequency	610 kHz
Dissipation Factor	<2.0%
Capacitance	260 nF $\pm 15\%$
Operating Temperature	-25 to 130 °C
Curie Temperature	230 °C
External Electrodes	Screen-Printed Silver
Dimensions	Width 1: 3.0 mm $\pm 0.1$ mm Width 2: 3.0 mm $\pm 0.1$ mm Height: 2.0 mm $\pm 5 \mu\text{m}$



a. All specifications are quoted at 25 °C, unless otherwise stated.



### Drawing

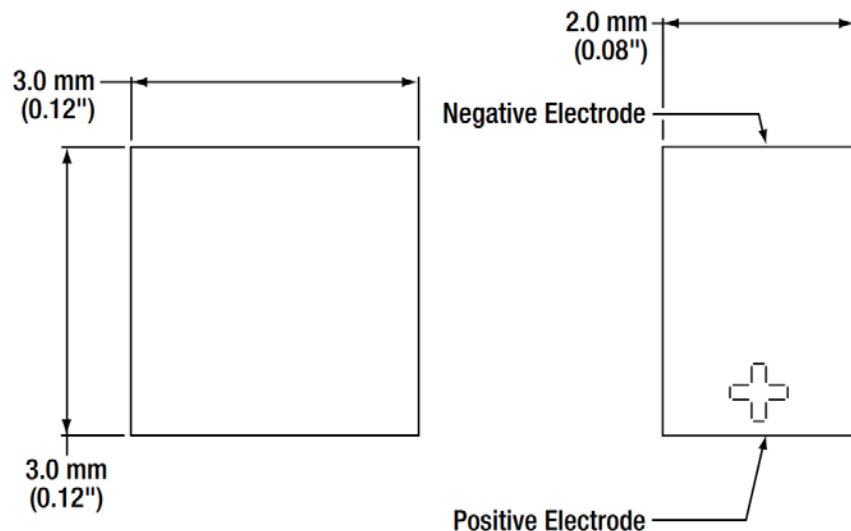

July 10, 2020

CTN003181-S01, Rev B

## Typical Performance Plots

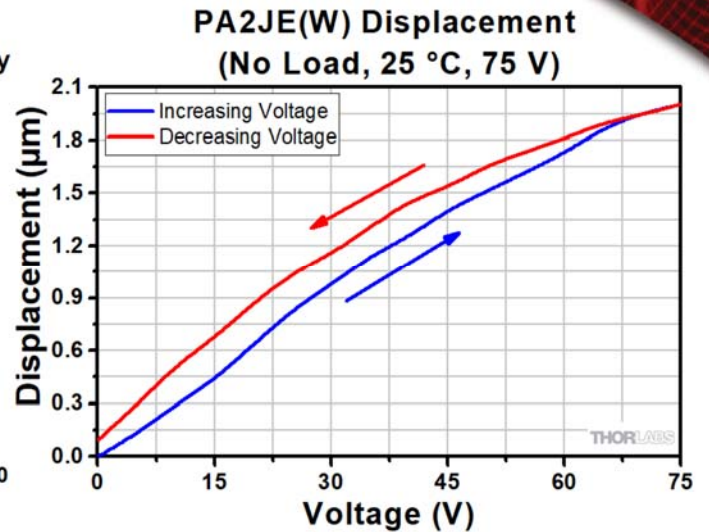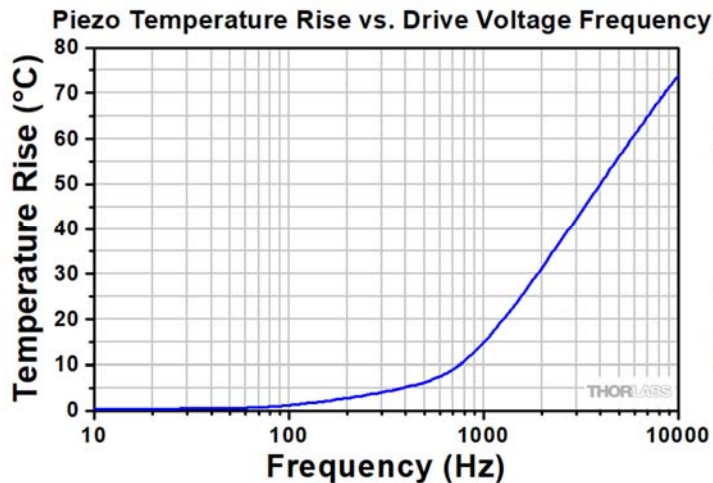

These temperature rises were measured after applying a sine-wave drive voltage ranging from 0 to 75 V at the specified frequency for 10 minutes.

## Operation

### Electrical Considerations

- The electrode closest to the silver plus sign should be positively biased, and the opposite electrode should be grounded. The maximum drive voltage is 75 V. Exceeding 75 V will decrease the device's lifespan and may cause mechanical failure. Reverse biasing may cause mechanical failure.
- When soldering wires to the electrodes, use a temperature no greater than 370 °C (700 °F) for a maximum of 2 seconds per spot. Solder to the middle of the electrode, keeping the spot as small as possible.
- Caution: After driving, the piezo is fully charged. Directly connecting the positive and negative electrodes has the risk of electricity discharging, spark, and even failure. We recommend using a resistor (>1 kΩ) between the electrodes to release the charge.

### Attaching Devices to the Piezo

- Any epoxy which cures at a temperature lower than 80 °C is safe to use. We recommend Thorlabs item # 353NDPK or TS10. Loctite Hysol 9340 can also be used.
- Loads should only be attached to the central area of the chip face since the edges do not translate. Attaching a load to the non-translating faces may lead to mechanical failure.

### Storage Instructions

- Do not store the device at temperatures above 80 °C.
- Do not store the device in humid environments. The relative humidity (RH) should be less than 40%.
- Do not immerse the device in organic solvents.
- Do not use the device around combustible gases or liquids.